

## Service Kit Instructions

### Series 90

## Replacement of control gasket

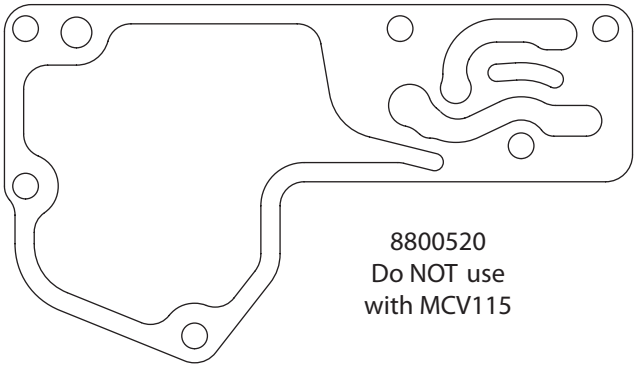
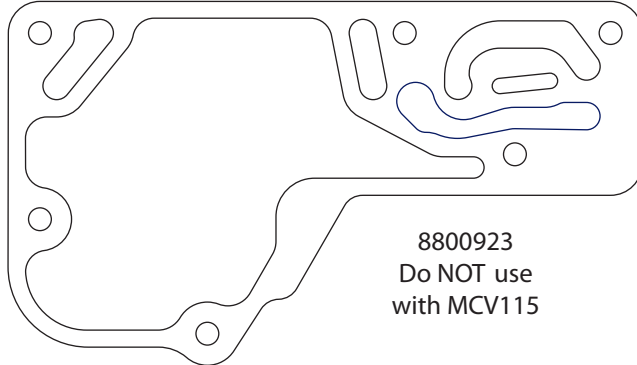
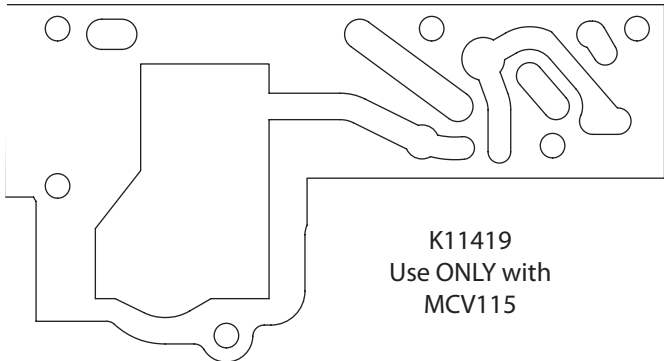
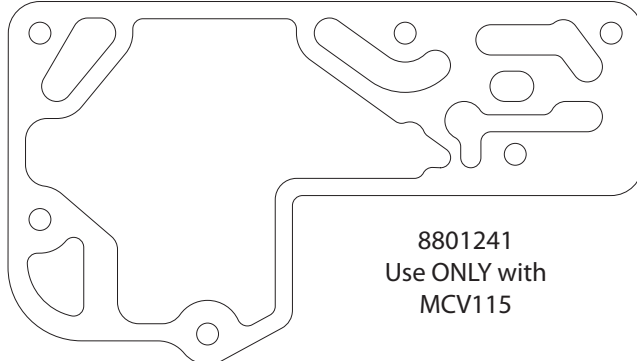


In October of 1992, Sauer-Danfoss began offering a new style hydraulic displacement control (MCV115) that is a direct replacement for the MCV112.

The control gasket also changed, and the new style gasket must be used with the MCV115 control. The old style gasket is to be used with the MCV112 control, all manual displacement controls, and MCV111 electric displacement controls.

#### WARNING

Failure to use the appropriate gasket may result in uncontrolled pump displacement.

30cc/42cc/55cc	75cc/100cc/130cc
 <p>8800520 Do NOT use with MCV115</p>	 <p>8800923 Do NOT use with MCV115</p>
 <p>K11419 Use ONLY with MCV115</p>	 <p>8801241 Use ONLY with MCV115</p>